


CORNER RECORD

City of Stockton

Document Number 09-78
County of San Joaquin, California

Brief Legal Description Re-established City of Stockton Control Monument "4N-5" in monument well on south side of Morada Lane approximately 200' west of the U.P.R.R. (formerly S.P.R.R.) tracks.

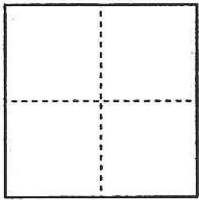

CORNER TYPE

Government Corner ☐
Meander ☐
Rancho ☐

Control ☒
Property ☐
Other ☐

Date of Survey Aug. 27, 2009
Sept. 29, 2009

COORDINATES (Optional)

N. _____
E. _____
Zone _____ NAD27 ☐ NAD83 ☐
NAD83 Epoch _____
Elev. _____
Vert. Datum: NGVD29 ☐ NAVD88 ☐
Meas. Units: Metric ☐ Imperial ☐

Corner - Left as found ☐ Found and tagged ☐ Established ☐ Reestablished ☒ Rebuilt ☐

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:

On Aug. 27, 2009, three monuments (two saw-cut crosses and a 3/4" iron pin in monument well) as shown on Corner Record CR-09-75 were relocated. The instrument was set over the most northeasterly saw-cut cross and a backsight was taken on the 3/4" iron pin in monument well. A bearing of South 83°50'03" West was calculated from record data shown on said corner record. The calculated distance of 857.88 feet was measured and verified. A double angle and measured distance to the most southeasterly saw-cut as shown on said corner record also agreed with calculated values. The instrument was then re-zeroed on the backsight and a calculated angle and record distance was used to set a nail at the obliterated monument's prior location per said corner record. Two-foot spreaders (concrete nails) were also placed at this time. A monument well and concrete cylinder were constructed by others at a later date. On Sept. 29, 2009 I returned to the site and using the two-foot spreaders set a City of Stockton 2-1/2" brass disk into the concrete cylinder. A mark was set into the surface of the disk with a drill and 1/8" bit.

A description of the physical condition of the monument as found and as set or reset:

Set 2-1/2" brass disk stamped "CITY OF STOCKTON SURVEY MONUMENT 4N-5 RESET LS7520" in monument well with drilled punch mark.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyors' Act on September 29, 2009.

Signed David W. Lanphear L.S. Number 7520




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received OCTOBER 14, 2009 and examined and filed OCTOBER 23, 2009.

Signed Thomas M. Gau R.C.E. No. 23341

For Title _____ County Surveyor

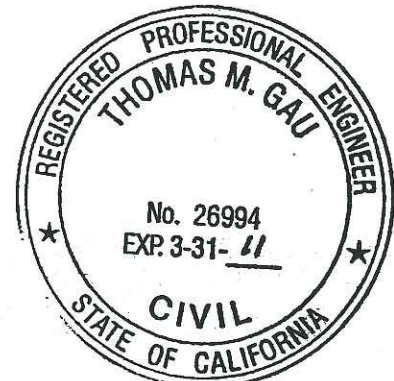

County Surveyor's Comment

(D.D. Sheet No. 28)

FOUND SAW-CUT CROSS ON
S.E. CORNER OF CONCRETE
BASE OF STREET LIGHT PER
CORNER RECORD CR-09-75

FOUND SAW-CUT CROSS ON
S.W. CORNER OF CONCRETE
BASE OF STREET LIGHT PER
CORNER RECORD CR-09-75

S12°10'50"W 106.41' CALCULATED
BEARING AND DISTANCE PER
DATA FROM CORNER RECORD
CR-09-75. VERIFIED BY
MEASUREMENT.

SET 2-1/2" BRASS DISK
STAMPED "CITY OF STOCKTON
SURVEY MONUMENT 4N-5
RESET LS7520" WITH DRILLED
PUNCH MARK IN MONUMENT
WELL

WESTERLY LINE OF 400'
WIDE U.P.R.R. R/W

S83°50'03"W 857.88' CALCULATED
BEARING AND DISTANCE PER
DATA FROM CORNER RECORD
CR-09-75. DISTANCE VERIFIED
BY MEASUREMENT.



FOUND 3/4" IRON PIN IN
MONUMENT BOX PER M.&P.
23-73, R.S. 28-180 AND
CORNER RECORD CR-09-75